

YOUR INSPECTION REPORT

PREPARED BY

Andy Slywka



FOR THE PROPERTY AT: 12345 Cranbrook Street Cranbrook, BC

PREPARED FOR: SAMPLE REPORT

INSPECTION DATE: Thursday, January 5, 2023

Out Of The Woods Home Inspection

Cranbrook, BC

250-417-1701

outofthewoodshomeinspection.com outofthewoodshomeinspection@gmail.com



Out Of The Woods

Home Inspection

This Summary outlines potentially significant issues from a cost or safety standpoint. This section is provided as a courtesy and cannot be considered a substitute for reading the entire report. Please read the complete document. <u>Priority Maintenance Items</u>

Exterior

WALLS \ General notes

Condition: • Damage
Potential pest damage noted under siding.
Location: Front exterior below window
Task: Further investigation required by contractor to determine damage and proper repair.
Time: Immediately upon possession

PORCHES, DECKS, STAIRS, PATIOS AND BALCONIES \ Columns / Posts

Condition: • Cracking noted in bricks where metal post is bearing.
Implication(s): Continued structural movement.
Location: Front entryway
Task: Monitor monthly for movement. If ongoing movement is noted engage contractor to further investigate and determine scope and cost of repair.
Time: Ongoing upon possession

LANDSCAPING \ General notes

Condition: • Trees or shrubs too close to building Large trees noted at front of home Implication(s): Chance of water damage to structure, finishes and contents | Chance of pests entering building | Material deterioration Location: Front exterior Task: Engage arborist for cost and scope of removal. Time: As soon as possible upon possession

Electrical

DISTRIBUTION SYSTEM \ Smoke alarms (detectors)

Condition: • Missing Missing smoke alarms noted Implication(s): Safety issue Location: Throughout Task: Install smoke alarms Time: Immediately upon possession STRUCTURE

APPENDIX

outofthewoodshomeinspection.com

INTERIOR

SUMMARY ROOFING

Heating

FURNACE \ Life expectancy

Condition: • Near end of life expectancy

Implication(s): Equipment failure | No heat for building

Location: Mechanical room

Task: Engage heating specialist to determine scope and cost of replacement. Anticipate replacement and budget accordingly.

INSULATION

PLUMBING

HEATING

Time: Before subject removal

Plumbing

SUPPLY PLUMBING \ Water supply piping in building

Condition: • Copper pipes generally have a life expectancy of 50 years. These pipes appear to be the original to the home, and therefore are nearing or at their expected life.

Location: Throughout

Task: Monitor monthly for leaks, should you see any signs of corrosion, drips, or leaks, immediately contact a plumber to repair.

Time: Regular maintenance and inspection required

WATER HEATER \ Life expectancy

Condition: • Near end of life expectancy Water heater is 11 years old Implication(s): No hot water Location: Basement mechanical room Task: Engage insurance provider. Engage plumbing contractor to determine cost and scope of replacement. Budget for replacement. Time: Before subject removal

This concludes the Summary section.

The remainder of the report describes each of the home's systems and also details any recommendations we have for improvements. Limitations that restricted our inspection are included as well.

The suggested time frames for completing recommendations are based on the limited information available during a pre-purchase home inspection. These may have to be adjusted based on the findings of specialists.

ROOFING

outofthewoodshomeinspection.com

		-,	.,						
SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	INSULATION	PLUMBING	INTERIOR	APPENDIX
Descrip	tion								
Roofing m • <u>Asphalt s</u> Where visit	hingles								
Flashing r • Metal Where visi									
	e expectanc be: • Gable	cy: • 20-25 y	vears						

Inspection Methods and Limitations

Inspection limited/prevented by:

• The visual inspection of the roof was limited by snow cover. The buyer is advised that the roof was not visible on the day of inspection and therefore it was not inspected. I recommend having the roof and it's associated systems inspected by a qualified professional once visible, to ensure that there are no issues or deficiencies.




Snow covered

Inspection performed: • From the ground

Not included as part of a building inspection: • Not readily accessible interiors of vent systems, flues, and chimneys

EXTERIOR

Report No. 1016, v.2

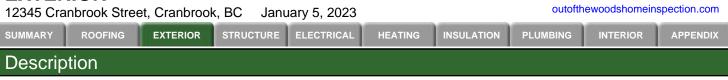

General:

Exterior photos





Front





Wall surfaces and trim:

• Vinyl siding

Right



Left

TERIOR

Report No. 1016, v.2

	EXTERIOR STRUCTURE ELECT	RICAL HEATING INSUL	ATION PLUMBING	INTERIOR	APPENDIX
		INICAL HEATING INCOL		INTERIOR	
	Vinul aiding				
	Vinyl siding				
<u>Stucco</u>					
	Stucco				
nspection Mat	nods and Limitations				
nspection met	ious and Limitations				
	revented by: • Snow / ice / frost				
		1.4 4.4	of the home. Recom		

Exterior inspected from: • Ground level

Not included as part of a building inspection: • Screens, shutters, awnings, and similar seasonal accessories • Fences and boundary walls • Geological and soil conditions

EXTERIOR

Report No. 1016, v.2

outofthewoodshomeinspection.com

12345 Cranbrook Street, Cranbrook, BC January 5, 2023 SUMMARY ROOFING EXTERIOR PLUMBING APPENDIX **Observations and Recommendations** WALLS \ General notes Condition: • Damage Potential pest damage noted under siding. Location: Front exterior below window Task: Further investigation required by contractor to determine damage and proper repair. Time: Immediately upon possession Damage

Damage

WALLS \ Soffits (underside of eaves) and fascia (front edge of eaves)

Condition: • Paint - deteriorated / missing Paint missing, and minor deterioration on end of beam Implication(s): Shortened life expectancy of material Location: Carport Task: Repaint Time: Regular maintenance

EXTERIOR 12345 Cranbrook Street, Cranbrook, BC January 5, 2023

Report No. 1016, v.2

SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	INSULATION	PLUMBING	INTERIOR	APPENDIX
			Doint do	tariaratad / m	iooina				

Paint - deteriorated / missing

WALLS \ Vinyl siding

Condition: • <u>Mechanical damage</u> Implication(s): Chance of water damage to structure, finishes and contents Location: Left exterior Task: Seal all openings to prevent pests and water ingress Time: Upon possession

Report No. 1016, v.2

EXTERIOR 123

		January 5, 2023			Outorin	ewoodshomeins	spection.com
MMARY ROOFING EXT	ERIOR STRU	UCTURE ELECTRICAL	HEATING	INSULATION	PLUMBING	INTERIOR	APPENDIX

Mechanica	al damage

WALLS \ Stucco


Condition: • Minor cracks Minor exterior cracks noted Implication(s): Shortened life expectancy of material. Chance of water damage to structure, finishes and contents, Material deterioration Location: Exterior throughout Task: Seal all exterior cracks Time: Regular maintenance

EXTERIOR

Report No. 1016, v.2

outofthewoodshomeinspection.com

12345 Cranbrook Street, Cranbrook, BC January 5, 2023

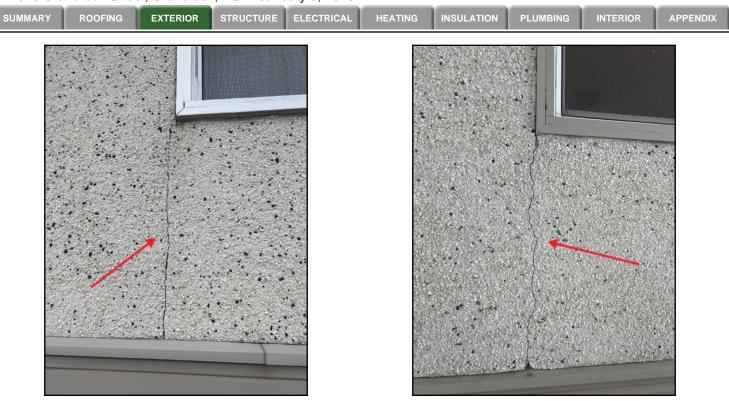

Minor cracks

Minor cracks



Minor cracks

EXTERIOR GLASS/WINDOWS \ Exterior trim

Condition: • Paint or stain needed

Implication(s): Chance of water damage to structure, finishes and contents | Material deterioration **Location**: Front exterior window

EXTERIOR		Report No. 1016, v.2
12345 Cranbrook Street, Cranbrook, BC	January 5, 2023	outofthewoodshomeinspection.com

SUMMARY ROOFING EXTERIOR STRUCTURE ELECTRICAL HEATING INSULATION PLUMBING INTERIOF	APPENDIX
--	----------

Task: Repaint Time: Regular maintenance



Paint needed

EXTERIOR GLASS/WINDOWS \ Window wells

Condition: • No drain noted in window well

Implication(s): Water ingress may damage contents and structure.

Location: Carport

Task: Ensure water and snow are kept away from window well. Install lip on concrete in front of window well to redirect water.

Time: Immediately upon possession



Window well

DOORS \ Exterior trim

Condition: • <u>No drip edge</u>

No drip edge noted above door and gap noted the side door trim. **Implication(s)**: Chance of damage to finishes and structure

EXTER	RIOR							Report No	. 1016, v.2
12345 Cra	nbrook Stree	et, Cranbrook	k, BC Janu	ary 5, 2023			outofth	ewoodshomein	spection.com
SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	INSULATION	PLUMBING	INTERIOR	APPENDIX

Location: Exterior entry of carport

Task: Install proper drip edge, as well as seal area between stucco and door trim.

Time: Soon as practical upon possession



No drip edge

PORCHES, DECKS, STAIRS, PATIOS AND BALCONIES \ Columns / Posts

Condition: • Twisted post noted

Implication(s): Continued movement of post may impact structural bearing and support.

Location: Carport

Task: Replace twisted post to ensure proper bearing

Time: As soon as practical



Twisted post

EXTERIOR

12345 Cranbrook Street, Cranbrook, BC January 5, 2023

outofthewoodshomeinspection.com

SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	INSULATION	PLUMBING	INTERIOR	APPENDIX
Condition	: • Cracking	noted in brid	ks where me	etal post is be	aring.				
Implicatio	Implication(s): Continued structural movement.								
Location:	Front entryw	/av							

Task: Monitor monthly for movement. If ongoing movement is noted engage contractor to further investigate and determine scope and cost of repair.

Time: Ongoing upon possession



Cracked bricks

PORCHES, DECKS, STAIRS, PATIOS AND BALCONIES \ Stairs and landings

Condition: • <u>Stair rise too big or not uniform</u> Ununiform rise on stair treads noted Implication(s): Trip or fall hazard Location: Front entryway Task: Be aware of ununiform rise in stairs. Ensure visible to others. Time: Discretionary

EXTERIOR

outofthewoodshomeinspection.com 12345 Cranbrook Street, Cranbrook, BC January 5, 2023 PLUMBING SUMMARY ROOFING EXTERIOR APPENDIX Rise, tread depth (run) and nosing max rise: roughly 8" nosing: typically 1 rise riser depth min tread depth (run) 10" US 8-1/4" CAN Stair rise not uniform PORCHES, DECKS, STAIRS, PATIOS AND BALCONIES \ Handrails and guards

Condition: • <u>Missing</u> Implication(s): Fall hazard Location: Front exterior entry Task: Install handrail Time: Upon possession

Report No. 1016, v.2

Report No. 1016, v.2

EXTERIOR

12345 Cranbrook Street, Cranbrook, BC January 5, 2023



Missing guard rail noted on front entryway Implication(s): Fall hazard

EXTER	RIOR							Report No	. 1016, v.2
	anbrook Stree	et, Cranbrook	k, BC Janu	ary 5, 2023			outofth	ewoodshomeins	spection.com
SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	INSULATION	PLUMBING	INTERIOR	APPENDIX

Location: Front entry Task: Install guard rail Time: Upon possession



Missing guard rail

LANDSCAPING \ General notes

Condition: • Planters and gardens against walls

Flower bed noted against foundation

Implication(s): Chance of water entering building | Chance of damage to structure | Chance of structural movement **Location**: Front exterior

Task: Remove flower bed or move flower bed away from exterior foundation. wall

Time: Upon possession


EXTERIOR

12345 Cranbrook Street, Cranbrook, BC January 5, 2023

Report No. 1016, v.2



outofthewoodshomeinspection.com

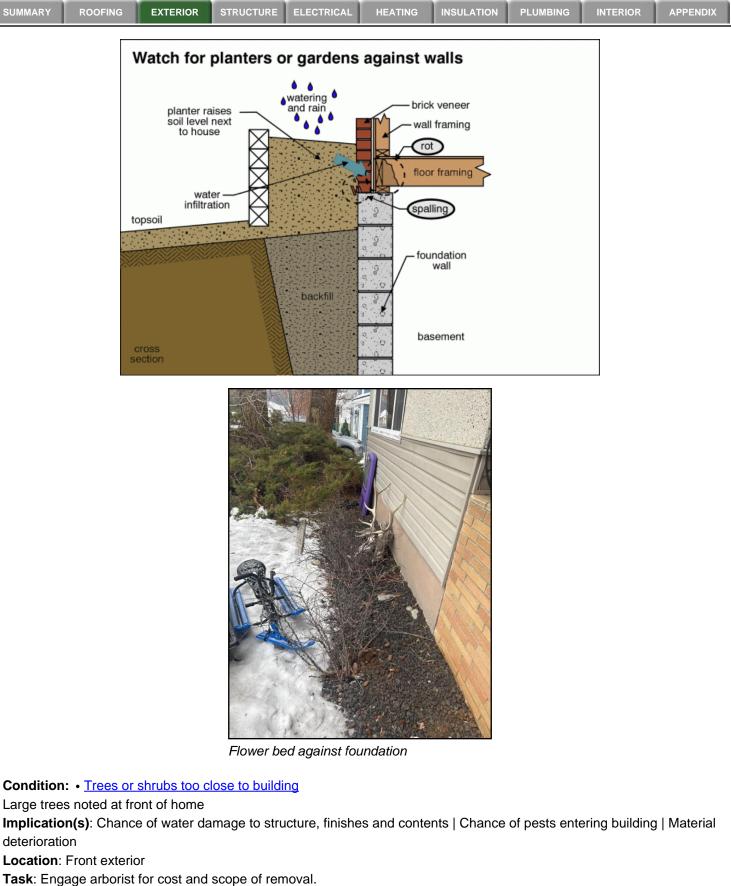

Providing great home inspections for every client every time

Page 16 of 61



LANDSCAPING \ Driveway Condition: • Cracked or damaged surfaces

Providing great home inspections for every client every time

Page 17 of 61

Implication(s): Open cracks in the driveway allow water to enter and freeze. This may cause further damage or lifting to the driveway creating a tripping hazard.

Location: Driveway

Task: Seal cracks to prevent water ingress and further damage from freeze/thaw cycles. Monitor for ongoing movement. If movement continues replacement may be nessisary.

Time: Ongoing



Cracked surfaces

Condition: • Unsealed gap at building Implication(s): Chance of water damage to structure, finishes and contents Location: Carport driveway Task: Seal gap Time: Upon possession

Report No. 1016, v.2

EXTERIOR 12345 Cranbrook Street, Cranbrook, BC

outofthewoodshomeinspection.com

SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	INSULATION	PLUMBING	INTERIOR	APPENDIX

Unsealed gap at building

January 5, 2023

STRUCTURE

12345 Cranbrook Street, Cranbrook, BC January 5, 2023

Report No. 1016, v.2

outofthewoodshomeinspection.com

			, <u> </u>								
SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	INSULATION	PLUMBING	INTERIOR	APPENDIX		
Description											
Configura	tion: • Base	ement									
Foundatio	on material:	Not visible									
Floor construction:											
• <u>Joists</u>											
Where visi	IDIE										
Exterior w	all construe	ction: • Not	visible								
Roof and	ceiling fram	ing: • Rafte	rs								

Inspection Methods and Limitations

Attic/roof space: • Inspected from access hatch

	RICAL	et, Cranbrooł	k, BC Janu			outofth	Report No	,	
SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	INSULATION	PLUMBING	INTERIOR	APPENDIX
Description									
Service entrance cable and location: • <u>Overhead</u>									



Overhead

Service size:

• 100 Amps (240 Volts)



100 Amps (240 Volts)

ELEC1	RICAL							Report No	. 1016, v.2
12345 Cra	anbrook Stree	et, Cranbrool	k, BC Janu	uary 5, 2023			outofth	ewoodshomein	spection.com
SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	INSULATION	PLUMBING	INTERIOR	APPENDIX

Main disconnect/service box type and location:

Breakers - basement



Breakers - basement

System grounding material and type:

<u>Copper - water pipe</u>



Copper - water pipe

Distribution wire (conductor) material and type: • Copper - non-metallic sheathed

Circuit interrupters: Ground Fault (GFCI) & Arc Fault (AFCI):

• GFCI - bathroom

<text><text><text><text><text>

GFCI - bathroom 2

GFCI - bathroom 1

No AFCI

Smoke alarms (detectors):

Present

Some smoke alarms present.


Carbon monoxide (CO) alarms (detectors):

Present

ELECTRICAL 12345 Cranbrook Street, Crar SUMMARY ROOFING EXTER		uary 5, 2023							
	CO deter								
Inspection Methods and Limitations System ground: • Continuity not verified Circuit labels: • The accuracy of the circuit index (labels) was not verified.									
Observations and Re SERVICE BOX, GROUNDING Condition: • Unprotected ope	AND PANEL \								


Unprotected opening noted in distribution box Implication(s): Electric shock Location: Distribution box Task: Repair Time: Immediately upon possession

Report No. 1016, v.2

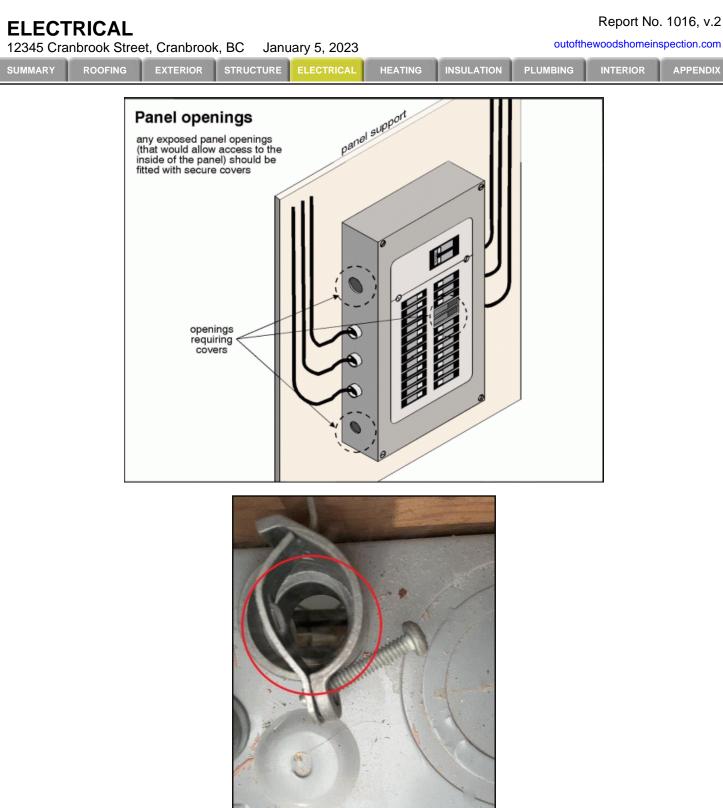


Unprotected openings

Condition:
• Poor access Clothes hanger noted in front of distribution panel Implication(s): Difficult to service

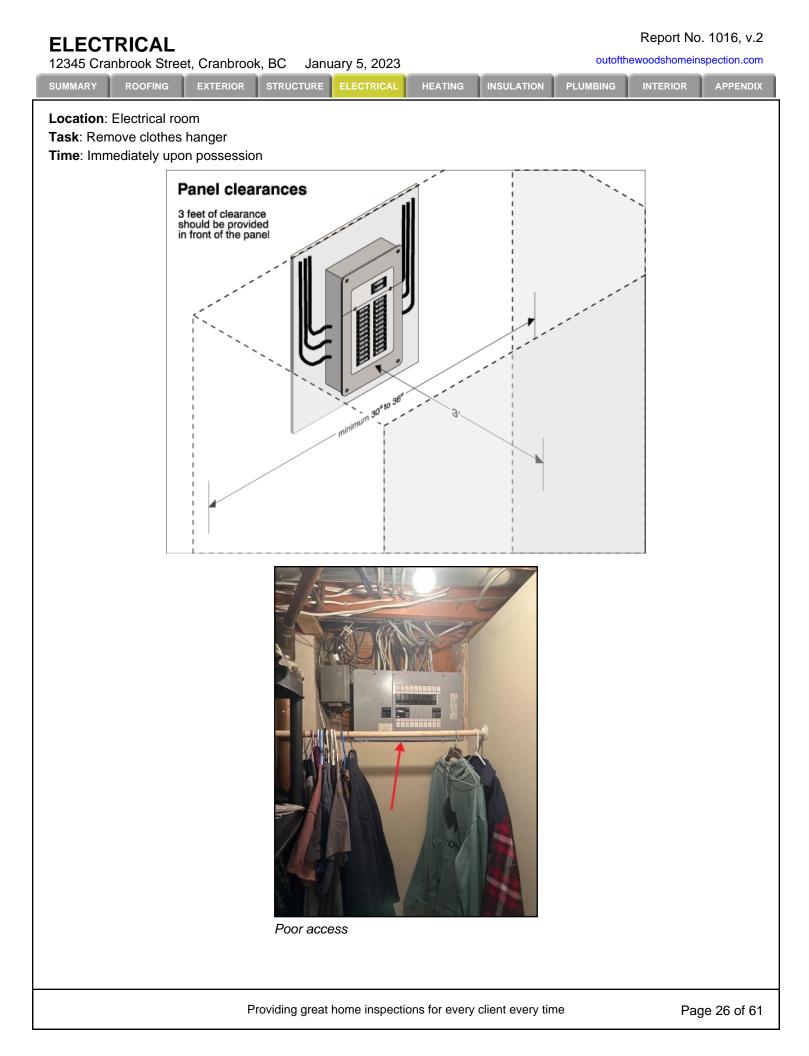

ELECTRICAI		k, BC Janu	ary 5, 2023			outofth	Report No.	
SUMMARY ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	INSULATION	PLUMBING	INTERIOR	APPENDIX
DISTRIBUTION SYS Condition: • Too cl Implication(s): Elect Location: Electrical Task: Improve Time: Immediately u	<u>ose to/touching</u> tric shock Fire room	ducts, pipe, hazard	•					
	Wire clear	ances fron	n hot ducts	s and pip	es			

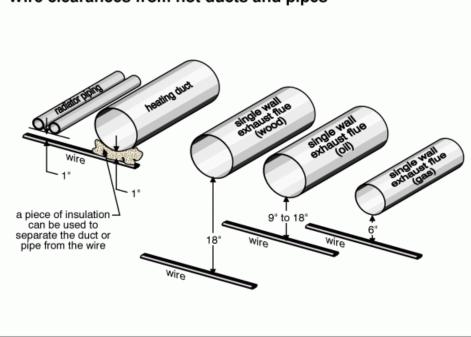



Wires touching ducts

ELECTRICAL 12345 Cranbrook Stree SUMMARY ROOFING	et, Cranbrook	INSULATION	Outofth	Report No. ewoodshomeins				
Condition: • Exposed Implication(s): Electric Location: Attic Task: Improve Time: Immediately upo	shock							

Exposed in attics

DISTRIBUTION SYSTEM \ Outlets (receptacles)

Condition: • Damage Damaged face plate noted Implication(s): Electric shock | Fire hazard Location: Basement bedroom Task: Replace Time: Immediately upon possession

Report No. 1016, v.2

ELECTRICAL 12345 Cranbrook Street, Cranbrook, BC January 5, 2023

outofthewoodshomeinspection.com

12010 010				ary 0, 2020					
SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	INSULATION	PLUMBING	INTERIOR	APPENDIX

Damage

DISTRIBUTION SYSTEM \ GFCI (Ground Fault Circuit Interrupter) protection not noted at

Condition: • Kitchen counters

GFCI plugs missing

Location: Around kitchen sink

Task: Recommend improvement and installing GFCI receptacles

Time: Immediately upon possession



GFCI plugs missing

DISTRIBUTION SYSTEM \ Switches

Condition:
• Damage

	RICAL nbrook Stree ROOFING	et, Cranbroo exterior	k, BC Janu structure	iary 5, 2023 Electrical	HEATING	INSULATION	Outofth PLUMBING	Report No ewoodshomeine INTERIOR	. 1016, v.2 spection.com APPENDIX
Location: Task: Rep	n(s): Electric Mechanical air nediately upo	room							

Damage

DISTRIBUTION SYSTEM \ Cover plates

Condition: • For junction box is missing Cover missing Implication(s): Electric shock Location: Mechanical room above water heater Task: Improve Time: Immediately upon possession ELECTRICAL 12345 Cranbrook Street, Cranbrook, BC January 5, 2023

Report No. 1016, v.2

outofthewoodshomeinspection.com

	SUMMARY ROOFING	EXTERIOR STRUCTURE	ELECTRICAL	HEATING	INSULATION	PLUMBING	INTERIOR	APPENDIX
For iuntion how in missing								

For junction box is missing

DISTRIBUTION SYSTEM \ Lights

Condition: • Inoperative No bulbs and fluorescent light. Damage on fixture also noted. Implication(s): Inadequate lighting Location: Mechanical room Task: Repair Time: Upon possession



Inoperative

DISTRIBUTION SYSTEM \ Smoke alarms (detectors)

Condition: • Missing

ELECTRICAL 12345 Cranbrook Street, Cranbrook, BC January 5, 2023		Report No. 1016, v.2 outofthewoodshomeinspection.com			
SUMMARY ROOFING EXTERIOR STRUCTURE ELECTRICAL	HEATING INSULATION	PLUMBING	INTERIOR	APPENDIX	
Missing smoke alarms noted Implication(s): Safety issue Location: Throughout Task: Install smoke alarms Time: Immediately upon possession					

	HEATING Report No. 1016, v.2 2345 Cranbrook Street, Cranbrook, BC January 5, 2023 outofthewoodshomeinspection.com										
SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	INSULATION	PLUMBING	INTERIOR	APPENDIX		
Descrip	tion										
Heating sy • Furnace	ystem type:				*						

Furnace

Fuel/energy source: • Gas

Approximate capacity: • <u>100,000 BTU/hr</u>

Efficiency:
• <u>Mid-efficiency</u>

Exhaust venting method: • Induced draft

Combustion air source:
• Interior of building

Approximate age: • <u>19 years</u>

Typical life expectancy: • Furnace (conventional or mid-efficiency) 18 to 25 years

Main fuel shut off at: • Meter

Fireplace/stove:

<u>Gas fireplace</u>

Data plate

P/N 101449

Report No. 1016, v.2

HEATING 12345 Cranbrook Street, Cranbrook, BC January 5, 2023

outofthewoodshomeinspection.com

12345 Urar	IDIOOK Stree	i, Ciandrool							
SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	INSULATION	PLUMBING	INTERIOR	APPENDIX
			Gas firept	lace					

Location of the thermostat for the heating system:

Hallway



Thermostat

HEATING

SUMMARY

outofthewoodshomeinspection.com

12345 Cranbrook Street, Cranbrook, BC January 5, 2023

HEATING

APPENDIX

Inspection Methods and Limitations

Inspection prevented/limited by:

ROOFING

· System was shut off

Pilot light on gas fireplace was not on at time of inspection. Correct operation could not be verified.

STRUCTURE



System was shut off

Not included as part of a building inspection: • Heat loss calculations

Observations and Recommendations

FURNACE \ Life expectancy

Condition: • Near end of life expectancy

Implication(s): Equipment failure | No heat for building

Location: Mechanical room

Task: Engage heating specialist to determine scope and cost of replacement. Anticipate replacement and budget accordingly.

Time: Before subject removal

HEATING 12345 Cranbrook Street, Cranbrook, BC January 5, 2023

outofthewoodshomeinspection.com

SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	INSULATION	PLUMBING	INTERIOR	APPENDIX
						Ait Free			

Near end of life expectancy

INSULATION AND VENTILATION

12345 Cranbrook Street, Cranbrook, BC January 5, 2023 Report No. 1016, v.2

outofthewoodshomeinspection.com ROOFING INSULATION PLUMBING APPENDIX

Description

SUMMARY

General: • General attic photos





Attic/roof insulation material: • Cellulose Attic/roof insulation amount/value: • 10 inches Attic/roof air/vapor barrier: • Not visible Attic/roof ventilation:
• Roof and soffit vents Wall insulation material: • Not visible Wall insulation amount/value: • Not visible

Wall air/vapor barrier: • Not determined

Mechanical ventilation system for building: • None

There has been no specific automatic air circulation device installed in this home. During heating and cooling seasons you will get fresh air into the home via the fresh air intakes on the HVAC system. During other times of the year, having a bathroom fan come on throughout the day (timer switch can take care of this), programming your thermostat (if possible) to have the furnace fan circulate the air, or opening windows are 3 easy ways to accomplish this.

N P . **T** 11 -

INSULA	TION A		NTILATI	ON				Report No	. 1010, v
12345 Crant	prook Stree	et, Cranbroo	k, BC Janu	ary 5, 2023			outofth	ewoodshomein	spection.co
SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	INSULATION	PLUMBING	INTERIOR	APPENI
Inspectio	n Metho	ods and	Limitation	S					
Attic inspec	tion perfo	rmed: • Fro	om access ha	ıtch					
	nen pene								

Report No. 1016, v.2

PLUMBING							-	. 1016, v.2
12345 Cranbrook Str	eet, Cranbroo	k, BC Janu	uary 5, 2023			outofth	newoodshomeins	spection.com
SUMMARY ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	INSULATION	PLUMBING	INTERIOR	APPENDIX
Description								
Supply piping in bu	Iding: • <u>Cop</u>	per • Plastic						
Main water shut off Basement Inside closet in baser 								

Water shut off

Water heater type:

• Conventional

PLUMBING

Report No. 1016, v.2

outofthewoodshomeinspection.com

12345 Cranbrook Street, Cranbrook, BC January 5, 2023	outofthewoodshomeinspection.com
SUMMARY ROOFING EXTERIOR STRUCTURE ELECTRICAL	HEATING INSULATION PLUMBING INTERIOR APPENDIX
<image/> <image/> <caption></caption>	<complex-block></complex-block>
Water heater fuel/energy source: • Gas	
Water heater exhaust venting method and combustion ai	r source: • Natural draft
Water heater manufacturer: • House air	
Water heater tank capacity: • 40 gallons	
Water heater approximate age: • 11 years	
Water heater typical life expectancy: • 8 to 12 years	
Waste and vent piping in building: • ABS plastic	
Pumps: • <u>Sump pump</u>	

PLUMBING 12345 Cranbrook Street, Cranbrook, BC January 5, 2023

Report No. 1016, v.2

outofthewoodshomeinspection.com

		aary 0, 2020					
SUMMARY ROOFING	EXTERIOR STRUCTURE	ELECTRICAL	HEATING	INSULATION	PLUMBING	INTERIOR	APPENDIX

Sump pump

Floor drain location: • Near laundry area

Gas meter location:

• Exterior rear



Gas meter

Providing great home inspections for every client every time

APPENDIX

PLUMBING

12345 Cranbrook Street, Cranbrook, BC January 5, 2023

SUMMARY

ROOFING EXTERIOR

HEATING INSUL

PLUMBING

Gas piping material: • Steel

Main gas shut off valve location: • Gas meter

Observations and Recommendations

SUPPLY PLUMBING \ Water supply piping in building

Condition: • Copper pipes generally have a life expectancy of 50 years. These pipes appear to be the original to the home, and therefore are nearing or at their expected life.

Location: Throughout

Task: Monitor monthly for leaks, should you see any signs of corrosion, drips, or leaks, immediately contact a plumber to repair.

Time: Regular maintenance and inspection required



Old copper pipes

Condition: • Older rubber connection lines noted. Location: Behind washing machine Task: Install steel braided lines Time: Upon possession

PLUMBING 12345 Cranbrook Street, Cranbrook, BC January 5, 2023

Report No. 1016, v.2

outofthewoodshomeinspection.com

SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	INSULATION	PLUMBING	INTERIOR	APPENDIX
				haraannaatia		-1			

Older rubber connection lines noted.

WATER HEATER \ Life expectancy

Condition:
• <u>Near end of life expectancy</u>

Water heater is 11 years old

Implication(s): No hot water

Location: Basement mechanical room

Task: Engage insurance provider. Engage plumbing contractor to determine cost and scope of replacement. Budget for replacement.

Time: Before subject removal

PLUMBING 12345 Cranbrook Street, Cranbrook, BC January 5, 2023

Report No. 1016, v.2

outofthewoodshomeinspection.com

SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	INSULATION	PLUMBING	INTERIOR	APPENDIX

Near end of life expectancy

FIXTURES AND FAUCETS \ Faucet

Condition: • Loose Loose Fossett noted Implication(s): Equipment failure Location: Kitchen Task: Repair Time: Upon possession

PLUMBING 12345 Cranbrook Street, Cranbrook, BC January 5, 2023

outofthewoodshomeinspection.com

SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	INSULATION	PLUMBING	INTERIOR	APPENDIX
					F				

Loose

FIXTURES AND FAUCETS \ Basin, sink and laundry tub

Condition: • Leak Leak noted on drain Implication(s): Chance of water damage to structure, finishes and contents Location: Laundry sink Task: Repair Time: Before use

PLUMBING 12345 Cranbrook Street, Cranbrook, BC January 5, 2023

Report No. 1016, v.2

2023 outofthewoodshomeinspection.com

SUMMARY ROOFING	EXTERIOR STRUCTURE ELECTRICAL	INSULATION	PLUMBING	INTERIOR	APPENDIX
	<image/>				
FIXTURES AND FAUC Condition: • <u>Slow drain</u>					
Slow drain noted	<u>.</u>				

Slow drain noted

Implication(s): Chance of water damage to structure, finishes and contents

Location: Basement bathroom

Task: Improve

Time: Upon possession

PLUMBING

			anuary 5, 2023					-
SUMMARY ROO	DFING EXTERIOR	STRUCTU	RE ELECTRICAL	HEATING	INSULATION	PLUMBING	INTERIOR	APPENDIX
	Inspectin	g a batht		e wer) nage leter e tub g/loose soap section, he spout e tub/ ersection		C		
					E			
	shower rod omitted for	and curtain			-			



Slow drain

APPENDIX

outofthewoodshomeinspection.com

INTERIOR

INTERIOR

12345 Cranbrook Street, Cranbrook, BC January 5, 2023

SUMMARY ROOFING

Description

General:

- Homes built prior to 1990 may contain materials that are now considered hazardous. Please visit: www.worksafebc.com to familiarize yourself with safe practises for handling these materials.
- Kitchon
- Kitchen



Kitchen



Living room

Bathroom

• Living room

Providing great home inspections for every client every time

Page 48 of 61


INTERIOR 12345 Cranbrook Street, Cranbrook, BC

outofthewoodshomeinspection.com

Report No. 1016, v.2

	 ~		_	~~~~				

January 5, 2023 STRUCTURE INSULATION PLUMBING SUMMARY ROOFING APPENDIX INTERIOR

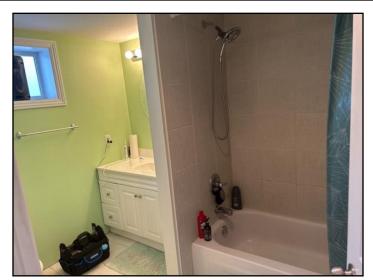

Bathroom 1

Bathroom



Bathroom 2

Bedroom

INTERIOR

outofthewoodshomeinspection.com

12345 Cranbrook Street, Cranbrook		outofth	newoodshomeins	spection.com			
SUMMARY ROOFING EXTERIOR	STRUCTUR	E ELECTRICAL	HEATING	INSULATION	PLUMBING	INTERIOR	APPENDIX
Dedreem	Bedrood						
• Bedroom							


Bedroom 2

Bedroom

INTERIOR 12345 Cranbrook Street, Cranbrook, BC

Report No. 1016, v.2

12345 Cranbrook Street, Cranbrook, BC January 5, 2023						outofth	ewoodshomeins	spection.com
SUMMARY ROOFING EXTERIOR STRUCTURE ELECTRICAL HEATING INSULATION PLUMBING INTERIOR					APPENDIX			

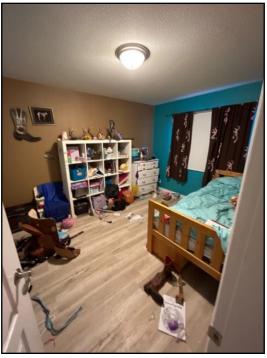

Bedroom 3

Bedroom



Bedroom 4

Major floor finishes: • Carpet • Vinyl • Tile Major wall and ceiling finishes: • Plaster/drywall

Providing great home inspections for every client every time

INTERIOR Report No.	1016, v.2
12345 Cranbrook Street, Cranbrook, BC January 5, 2023 outofthewoodshomeins	pection.com
SUMMARY ROOFING EXTERIOR STRUCTURE ELECTRICAL HEATING INSULATION PLUMBING INTERIOR	APPENDIX
Windows: • <u>Sliders</u> • Vinyl	
Exterior doors - type/material: • Hinged • Metal-clad	
Interior doors - type/material: • Hinged • Wood	
Kitchen ventilation:Exhaust fan discharges to the exterior	

Exhaust fan discharges to the exterior

Bathroom ventilation: • Exhaust fan

Inspection Methods and Limitations

Inspection limited/prevented by: • Storage/furnishings • Storage in closets and cabinets / cupboards

Observations and Recommendations

CEILINGS \ General notes

Condition: • Water stains

Water stains on ceiling noted but all stains tested dry with the moisture meter at the time of inspection.

Implication(s): Chance of water damage to structure, finishes and contents

Location: Basement

Task: Monitor these areas regularly upon possession for any signs of new or reoccurring leaks. If any signs of leakage occurs immediately contact contractor to repair.

Time: Ongoing

INTERIOR 12345 Cranbrook Street, Cranbrook, BC January 5, 2023

outofthewoodshomeinspection.com

SUMMARY ROOFING EXTERIOR STRUCTURE ELECTRICAL	HEATING INSULATION	PLUMBING INTERIOR	R APPENDIX
When I tell you When I tell you How Y			

Water stains

WALLS \ Plaster or drywall

Condition: • Damaged Minor damage noted Implication(s): Cosmetic damage Location: Basement stairs Task: Repair Time: Regular maintenance

INTERIOR 12345 Cranbrook Street, Cranbrook, BC January 5, 2023

outofthewoodshomeinspection.com

SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	INSULATION	PLUMBING	INTERIOR	APPENDIX
			Damaged						


STAIRS \ Handrails and guards

Condition: • Missing Missing handrail noted Implication(s): Fall hazard Location: Basement stairs Task: Install handrail Time: Immediately upon possession

INTERIOR

Report No. 1016, v.2

outofthewoodshomeinspection.com

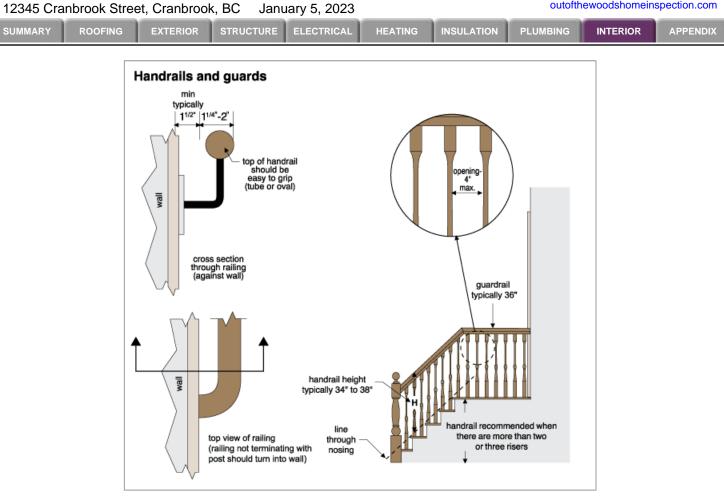



Missing

Providing great home inspections for every client every time

INTERIOR 12345 Cranbrook Street, Cranbrook, BC January 5, 2023 SUMMARY ROOFING EXTERIOR STRUCTURE ELECTRICAL HEATING INSULATION	Report No. 1016, v.2 outofthewoodshomeinspection.com PLUMBING INTERIOR APPENDIX
END OF REPORT	

12345 Granbrook Offeet, Granbrook, Do Gandary 5, 2025										
SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	INSULATION	PLUMBING	INTERIOR	APPENDIX	
	HOP HOP	S ASSOCIATION								

SH COLUMBIC

HOME INSPECTORS ASSOCIATION BC

SCOPE OF INSPECTION

The purpose of this Scope of Inspection is to establish a minimum, uniform standard for Home Inspectors Association BC home and property inspector members.

This Scope of Inspection of home inspection identifies the range of services and activities that the licensed members of this profession are educated and legally required to provide. The document describes the professional activities and areas of professional practice. The Scope of Inspection defines the minimum standard of practice for all HIA home inspections in British Columbia. The scope of work of an individual home inspector must meet the requirements outlined in this document but may include additional inspection services where the home inspector is qualified and / or has special knowledge. The scope of the home inspector's review of a home is a contractual matter, therefore, any additional services provided to the client beyond the Scope of Inspection, must be communicated through a contractual agreement with the client.

The working premise of this document is that licensed home inspectors will demonstrate minimum, entry level competencies and will conduct their work competently in a variety of home inspection environments. The practice requirements represent the expectations of a "typical" not an "expert" home inspector. A specialist may be hired to provide additional analysis and opinion of adverse conditions or defects identified, beyond this Scope of Inspection.

A home inspection is a limited, non-invasive, visual examination of the current condition of a residential building. A home inspection is designed to report observed deficiencies within specific systems and components of a home. A home inspection provides a description of the condition of the home based on observation of the visible and apparent condition of the structure and components at the time of the home inspection. A home inspection does not guarantee future condition, efficiency, or life expectancy of systems or components. It is not an inspection to verify compliance with any applicable building codes, municipal bylaws or other regulations. A home inspection will not reveal every problem that exists or could ever exist and is not a technically exhaustive inspection.

HOME INSPECTORS ASSOCIATION BC

CODE OF ETHICS

Honesty, justice, and courtesy form a moral philosophy which, associated with mutual interest among people, constitutes the foundation of ethics. The members should recognize such a standard, not in passive observance, but as a set of dynamic principles guiding their conduct. It is their duty to practice the profession according to this code of ethics.

As the keystone of professional conduct is integrity, the Members will discharge their duties with fidelity to the public, their clients, and with fairness and impartiality to all. They should uphold the honor and dignity of their profession and avoid association with any enterprise of questionable character, or apparent conflict of interest.

- 1. The member will express an opinion only when it is based on practical experience and honest conviction.
- 2. The member will always act in good faith toward each client.
- 3. The member will not disclose any information concerning the results of the inspection without the approval of the clients or their representatives.
- 4. The member will not accept compensation, financial or otherwise, from more than one interested party for the same service without the consent of all interested parties.
- Inspectors shall avoid conflicts of interest or activities that compromise, or appear to compromise, professional independence, objectivity, or inspection integrity.
- Home inspectors shall not, directly or indirectly compensate, provide or receive a thing of value, inducement or reward:

 to realtors, brokers or other parties having a financial vested interest in the closing or settlement of real estate transactions,
 - b. for the referral of any business to the inspector or the inspection company, or for inclusion on a list of recommended inspectors, preferred providers, or similar arrangements.
- 7. Members will not use or disclose personal information about clients, home owners, occupants, or the identity of the inspected property or its contents for purposes other than those for which it was collected:
 - a. except with the informed consent of the client, home owner, occupant, or any other person involved in the home inspection, or with the informed consent of all parties affected by the information, or as required by law.
- 8. The inspection work may not be used as a vehicle by the inspector to deliberately obtain work in another field.
- An inspector shall make every effort to uphold, maintain, and improve the professional integrity, reputation, and practice of the home inspection profession. He or she will report all such relevant information, including violations of this Code by other members, to the Association for possible remedial action.
- 10. No member shall be actively engaged as a broker or agent in the sale or purchase of real estate.
- 11. The Inspectors shall not repair any condition found during an inspection or give cost estimates.
- 12. Members shall always be objective in their reporting and not knowingly overstate or understate the significance of observed conditions.

Use of this HIABC Scope of Inspection does not guarantee that the Inspector is a member of Home Inspectors Association BC. To confirm membership, visit www.hiabc.ca

Home Inspectors Association BC www.hiabc.ca Scope of Inspection 2016

1

Providing great home inspections for every client every time

Page 57 of 61

	SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	INSULATION	PLUMBING	INTERIOR	APPENDIX
--	---------	---------	----------	-----------	------------	---------	------------	----------	----------	----------

HOME INSPECTORS ASSOCIATION

Introduction

The Home Inspectors Association BC is a not-for-profit professional society established in 1991. Membership in the Home Inspectors Association is voluntary and its members include private, fee-paid home inspectors. The Home Inspectors Association objectives include promotion of excellence within the profession and continual improvement of its members' inspection services to the public.

home inspector shall inspect readily accessible, visually Observable, installed systems and components of a residential building using typical fixed operational controls and report identifiable deficiencies of specific systems and components therein including:

- 1. Exterior Systems
- Roofing, Flashings, Penetrations and Chimneys 2.
- 3. Structural Systems
- Plumbing Systems 4
- Electrical Systems 5.
- 6. Interior components
- Heating, Ventilation and Cooling (HVAC) Systems 7.
- Fireplaces and Solid Fuel Burning Appliances 8.
- Insulation and Ventilation of Attics, Crawlspaces and 9. Unfinished Basements

Home Inspection Report

Inspections shall be accompanied by a documented report that:

- 1. Describes readily accessible systems and components of a residential building and their condition.
- 2. Makes recommendations on significant deficiencies identified for each system or component that is included in the inspection
- 3. Provides information regarding potential impact if the issues are not addressed
- 4. And includes anything else that is made part of the inspection in accordance with this Scope of Inspection and a home inspection contract

General Home Inspection Inclusions (applicable to all components)

Home inspectors are required to:

- Inspect readily accessible, visually observable, installed systems & 1. components of residential buildings using typical fixed operational controls
- 2. Describe and report systems or components with significant deficiencies or damage including, but not limited to, inadequate performance, missing components, decay, rot, water issues, or other home inspection concerns.
- 3. Describe and report deficiencies that are evident by means of sight, touch, smell and hearing
- Describe and report items that pose an imminent health or safety 4. concern in the opinion of the home inspector
- 5. Describe and report items for which a representative sample was inspected, including a description of the sampling process
- 6. Describe and report the rationale for exclusion and limitation to the inspection of any system, component, procedure or method included in this Scope of Inspection
- Recommend further evaluation or investigation by a 7. Qualified Professional where:
 - a. conditions are identified that may constitute a hazard to occupants
 - b. conditions and systems and components exceed the collective knowledge and training of the home inspector in the opinion of the home inspector
- 8. Include in the report, documentation of evidence, such as supporting images (such as photographs or sketches) to provide information regarding observed deficiencies, where deemed appropriate by the home inspector Produce the report in writing.
- 9
- Include in the report the significant components that appear 10. to be at or near the end of their normally expected service life.

SCOPE OF INSPECTION

General Home Inspection Exclusions (applicable to all components)

Home inspectors are NOT required to:

- 1. Predict the probability of failure or remaining service life of any system or component or offer any warranty, guarantee or certifications for any system or component
- 2. Describe the compliance with regulatory requirements (codes, regulations, laws, ordinances, etc.)
- 3. Estimate the cost for operation of a particular system or component and / or the cost of remediation of any identified conditions
- 4. Identify the cause(s) of observed conditions or deficiencies
- 5. Identify the methods, materials and cost(s) for correcting repairing or replacing) observed conditions
- 6. Identify the condition of systems or components that are inaccessible, obstructed, hidden or contain latent defects
- Identify the presence of any potential hazards including, but not limited to, asbestos, mould, PCB, infestations of vermin and wood destroying organisms, carcinogens, radon gas, lead paint, urea formaldehyde, toxic or flammable chemicals, noise, and contaminants in soil, water and air
- 8. Describe the adequacy, effectiveness, or efficiency of any system or component
- a Inspect common areas in multi-unit housing
- 10. Inspect systems and components that are not installed
- 11. Inspect decorative items
- 12. Operate any system or component that is shut down or that does not turn on with the use of typical fixed operational controls 13. Inspect underground items whether abandoned or active
- including, but not limited to, storage tanks and / or indications of their presence
- 14. Offer any advice regarding the purchase of the property
- 15. Enter an area or perform an inspection procedure or method in the opinion of the home inspector, could be dangerous to the home inspector or cause damage to the property or its systems or components, such as, but not limited to walking on roof surfaces, climbing ladders, entering attic spaces, etc.
- 16. Move items, contents, debris, soil, snow, ice or other equipment or dismantle any system or component that obstructs access or visibility for the home inspection
- 17. Review third-party reports including, but not limited to, depreciation reports and engineering reports
- 18. Identify and report any geological, geotechnical or hydrological conditions
- 19. Identify every problem that exists or could ever exist and report a technically exhaustive inspection

This Scope of Inspection is not required to limit inspectors from:

- A. Including other inspection services in addition to those required by this Scope of Inspection provided the inspector is appropriately qualified to do so.
- B. Excluding systems and components from the inspection if requested by the client or as dictated by circumstances at the time of the inspection

The Home Inspectors Association Scope of Inspection applies to inspections of part or all of a building for the following building types:

- 1. single family dwelling, detached, semi-detached, or row house
- multi-unit residential building
 residential building held in divided or undivided co- ownership
- residential building occupied in part for residential occupancy and in 4. part for a commercial occupancy, as long as the latter use does not exceed 40% of the building's total area, excluding the basement.

Home Inspectors Association BC www.hiabc.ca Scope of Inspection 2016 2

SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	INSULATION	PLUMBING	INTERIOR	APPENDIX
---------	---------	----------	-----------	------------	---------	------------	----------	----------	----------

HOME INSPECTORS ASSOCIATION

1. EXTERIOR SYSTEMS

1.1 The inspector shall:

- A. inspect:
- 1. exterior wall covering(s), flashing and trim.
- 2. all exterior doors. 3. attached or adjacent decks, balconies, steps, porches, and the associated railings
- 4. the eaves, soffits, and fascias where accessible from the ground level.
- 5. vegetation, grading, surface drainage on the property when any of these are likely to adversely affect the building.
- 6. walkways, patios, and driveways leading to dwelling entrances.
- 7. landscaping structure attached or adjacent to the building when likely to adversely affect the building.
- 8. primary garage or carport attached or detached.
- 9. garage doors and garage door operators.

B. describe

1. exterior wall covering(s).

- C. report:
- 1. the method(s) used to inspect the exterior wall elevations.

1.2 The inspector is NOT required to:

A. inspect:

- 1. screening, shutters, awnings, and similar seasonal accessories. 2. fences.
- geological, geotechnical or hydrological conditions. recreational facilities. 3
- 4
- 5. outbuildings.
- 6. seawalls, break-walls, dykes and docks.
- 7. erosion control and earth stabilization measures.

2. ROOF SYSTEMS

2.1 The inspector shall:

- A. inspect:
 - 1. readily accessible roof coverings.
 - 2. readily accessible roof drainage systems.
 - 3. readily accessible flashings
- 4. readily accessible skylights, chimneys, and roof penetrations. B. describe
- 1. the roof covering and report the method(s) used to inspect the roof C. report
- 1. the method(s) used to inspect the roof(s).

2.2 The inspector is NOT required to:

A. inspect:

- 1. antennae and satellite dishes.
- 2. interiors of flues or chimneys which are not readily accessible.
- other installed accessories. items attached to but not related to 3. the roof system(s).

3. STRUCTURAL SYSTEMS

3.1 The inspector shall:

A. inspect:

1. structural components including visible foundation and framing. 2. by probing a sample of structural components where deterioration is suspected or where clear indications of possible deterioration exist. Probing is NOT required when probing would damage any finished surface or where no deterioration is visible.

B. describe:

- 1. foundation(s)
- 2. floor structure(s).
- 3. wall structure(s)
- 4. ceiling structure(s).
- 5. roof structure(s).
- C. report:
- 1. on conditions limiting access to structural components.
- 2. methods used to inspect the under-floor crawl space.
- 3. methods used to inspect the attic(s).

3.2 The inspector is NOT required to:

A. provide any engineering service or architectural service.

B. offer an opinion as to the adequacy of any structural system or component.

4. PLUMBING SYSTEMS

4.1 The inspector shall:

- A. inspect:
- 1. interior water supply and distribution systems including all fixtures and faucets
- 2. drain, waste and vent systems including all fixture
- 3. water heating equipment and associated venting systems, flues & chimneys.
- fuel storage and fuel distribution systems.
- 5. drainage sumps, sump pumps, and related piping.

B. describe:

- 1. water supply, distribution, drain, waste, and vent piping materials.
- 2. water heating equipment including the energy source.
- 3. location of main water and main fuel shut-off valves.

4.2 The inspector is NOT required to:

- A. inspect:
 - 1. clothes washing machine connections.
 - 2. the interiors of flues or chimneys which are not readily accessible
 - 3. wells, well pumps, or water storage related equipment.
 - 4. water conditioning systems.
 - 5. solar water heating systems.
 - 6. fire and lawn sprinkler systems
 - private waste disposal systems. 7

B. determine:

- whether water supply and waste disposal systems are public or private.
 the quantity or quality of the water supply.
- C. operate:
- 1. safety valves or shut-off valves.

5. ELECTRICAL SYSTEMS

5.1 The inspector shall:

- A. inspect:
- 1. service drop.
- 2 service entrance conductors, cables, and raceways.
- 3. service equipment and main disconnects.
- service grounding. 4.
- 5. interior components of service panels and sub panels.
- 6. distribution conductors.
- 7. overcurrent protection devices.

absence of smoke detectors.

5.2 The inspector is NOT required to:

2. alarm systems and components.

5. telecommunication equipment.

1. amperage, voltage, or impedance.

- a representative number of installed lighting fixtures, switches, and 8. receptacles
- 9. the ground fault circuit interrupters (GFCI) (if appropriate).
- 10. arc fault circuit interrupters (AFCI) (if appropriate).

1. presence of solid conductor aluminum branch circuit wiring.

1. remote control devices unless the device is the only control device.

4. ancillary wiring, systems and components not a part of the primary

Page 59 of 61

2. absence of carbon monoxide detectors (if applicable).

presence of ground fault circuit interrupters (GFCI).

presence of arc fault circuit interrupters (AFCI).

3. low voltage wiring, systems and components.

electrical power distribution system.

1. amperage and voltage rating of the service.

2. location of main disconnect(s) and subpanel(s).

B. describe:

C. report:

3.

4.

A. inspect

B. measure:

Home Inspectors Association BC www.hiabc.ca Scope of Inspection 2016 3

Providing great home inspections for every client every time

3. wiring methods.

SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	INSULATION	PLUMBING	INTERIOR	APPENDIX
					9. INSULATIO	ON and VENTILA	TION of ATTICS	S. CRAWLSPAC	ES

6.1 The inspector shall:

A.inspect:

- walls, ceilings, and floors. 1.
- 2. steps, stairways, and railings
- countertops and a representative number of installed cabinets. 3.
- 4. a representative number of doors and windows.
- 5. walls,doors and ceiling separating the habitable spaces and the garage.

B.describe:

- 1. materials used for walls, ceilings and floors.
- 2. doors.
- 3. windows.
- C.report:
 - 1. absence or ineffectiveness of guards and handrails or other potentially physical injury hazards.

6.2 The inspector is NOT required to:

A.inspect:

- 1. paint, wallpaper, and other finish treatments.
- 2. carpeting.
- 3. window treatments.
- 4 central vacuum systems.
- 5 household appliances.
- 6. recreational facilities.

7. HEATING, VENTILATION & COOLING (HVAC) SYSTEMS

7.1 The inspector shall:

A. inspect:

- 1. readily accessible components of installed heating, central and
- through wall cooling equipment.
- 2. vent systems, flues, and chimneys. 3. fuel storage and fuel distribution systems.
- B. describe:

1. energy source(s).

- 2. heating and/or cooling method(s) by distinguishing characteristics.
- 3. chimney(s) and/or venting material(s).
- the combustion air sources. 4.
- 5. the exhaust venting methods (naturally aspirated, induced draft, direct vent, direct vent sealed combustion).

7.2 The inspector is NOT required to:

- A. inspect:
 - 1. interiors of flues or chimneys which are not readily accessible.
 - 2. heat exchanger.
- 3. humidifier or dehumidifier auxiliary equipment.
- 4. electronic air filters. 5. solar heating systems.

B. determine:

1. system adequacy or distribution balance.

8. FIREPLACES AND SOLID FUEL BURNING APPLIANCES

(Unless prohibited by the authority having jurisdiction)

8.1 The inspector shall:

- A. inspect:
- 1. system components
- 2. vent systems and chimneys
- B. describe:
 - 1. fireplaces and solid fuel burning appliances
- 2. chimneys

8.2 The inspector is NOT required to:

- A. inspect:
- 1. interior of flues or chimneys 2. screens, doors and dampers
- 3. seals and gaskets
- 4. automatic fuel feed devices
- 5. heat distribution assists whether fan assisted or gravity
- B. ignite or extinguish fires
- determine draught characteristics С.
- D. move fireplace inserts, stoves, or firebox contents

Home Inspectors Association BC www.hiabc.ca Scope of Inspection 2016 4

Providing great home inspections for every client every time

AND UNFINISHED BASEMENTS

9.1 The inspector shall:

- A.inspect:
 - 1.insulation and vapor retarders in unfinished spaces.
- 2.ventilation of attics and foundation areas.
- 3.mechanical ventilation systems
- 4.ventilation systems in areas such as kitchens, bathrooms and laundry areas where moisture is generated

B.describe:

- 1.type of insulation and vapour retarders in unfinished spaces.
- 2.ventilation of attics and foundation areas.
- 3.mechanical ventilation systems.
- 4.ventilation systems in areas such as kitchens, bathrooms and laundry areas where moisture is generated.
- C.report:
- 1.absence of insulation in unfinished spaces at conditioned surfaces. 2.absence of ventilation in areas where moisture is generated such as
- kitchens, bathrooms and laundry rooms.

9.2 The inspector is NOT required to:

- A.disturb insulation or vapor retarders.
- B.determine indoor air quality.
- C.determine system adequacy or distribution balance.

SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	INSULATION	PLUMBING	INTERIOR	APPENDIX
---------	---------	----------	-----------	------------	---------	------------	----------	----------	----------

GLOSSARY

HOME INSPECTORS ASSOCIATION

Adjacent

Nearest in space or position; immediately adjoining without intervening space.

Alarm Systems

Warning devices, installed or free-standing, including but not limited to; carbon monoxide detectors, flue gas and other spillage detectors, security equipment, ejector pumps and smoke alarms.

Architectural Service

Any practice involving the art and science of building design for construction of any structure or grouping of structures and the use of space within and surrounding the structures or the design for construction, including but not specifically limited to, schematic design, design development, preparation of construction contract documents, and administration of the construction contract, adequacy of design for the location and exposure to the elements.

Automatic Safety Controls

Devices designed and installed to protect systems and components from unsafe conditions.

Component

A part of a system.

Confined Spaces

An enclosed or partially enclosed area that:

1. Is occupied by people only for the purpose of completing work.

- 2. Has restricted entry/exit points.
- 3. Could be hazardous to people entering due to:
- a. its design, construction, location or atmosphere.
- b. the materials or substances in it, or

c. any other conditions which prevent normal inspection procedure.

Decorative

Ornamental; not required for the operation of the essential systems and components of a building

Describe

To report a system or component by its type or other observed, significant characteristics to distinguish it from other systems or components.

Determine

To find out; or come to a conclusion by investigation.

Dismantle

To take apart or remove any component, device, or piece of equipment that would not be taken apart or removed by a homeowner in the course of normal and routine home owner maintenance.

Engineering Service

Any professional service or creative work requiring engineering education, training, and experience and the application of special knowledge of the mathematical, physical and engineering sciences to such professional service or creative work as consultation, investigation, evaluation, planning, design and supervision of construction for the purpose of assuring compliance with the specifications and design, in conjunction with structures, buildings, machines, equipment, works or processes.

Functionality The purpose that something is designed or expected to fulfill.

Further Evaluation

Examination and analysis by a qualified professional, tradesman or service technician beyond that provided by the home inspection. Home Inspection

The process by which an inspector visually examines the readily accessible systems and components of a building and which describes those systems and components in accordance with this Scope of Inspection

Household Appliances

Kitchen, laundry, and similar appliances, whether installed or freestanding.

Inspect

To examine readily accessible systems and components of a building in accordance with these Scope of Inspection, where applicable using normal operating controls and opening readily openable access panels. Inspector

A person hired to examine any system or component of a building in accordance with this Scope of Inspection.

Installed

Set up or fixed in position for current use or service.

Monitor

Examine at regular intervals to detect evidence of change.

Normal Operating Controls

Devices such as thermostats, switches or valves intended to be operated by the homeowner. Operate

To cause to function, turn on, to control the function of a machine, process, or system.

Probing

Examine by touch Readily Accessible

Available for visual inspection without requiring moving of personal property, dismantling, destructive measures, or any action which will likely involve risk to persons or property.

Readily Openable Access Panel

A panel provided for homeowner inspection and maintenance that is within normal reach, can be removed by one person, and is not sealed in place

Recreational Facilities

Spas, saunas, steam baths, swimming pools, exercise, entertainment, athletic, playground or other similar equipment and associated accessories

Report

To communicate in writing.

Representative Number

One component per room for multiple similar interior components such as windows and electric outlets; one component on each side of the building for multiple similar exterior components.

Roof Drainage Systems

Components used to carry water off a roof and away from a building. Sample

A representative portion selected for inspection. Service Life/Lives

The period during which something continues to function fully as intended.

Significant Deficiency

A clearly definable hazard or a clearly definable potential for failure or is unsafe or not functioning

Shut Down

A state in which a system or component cannot be operated by normal operating controls

Solid Fuel Burning Appliances

A hearth and fire chamber or similar prepared place in which a fire may be built and which is built in conjunction with a chimney; or a listed assembly of a fire chamber, its chimney and related factory-made parts designed for unit assembly without requiring field construction.

Structural Component

A component that supports non-variable forces or weights (dead loads) and variable forces or weights (live loads).

System

A combination of interacting or interdependent components, assembled to carry out one or more functions.

Technically Exhaustive

An inspection is technically exhaustive when it is done by a specialist who may make extensive use of measurements, instruments, testing, calculations, and other means to develop scientific or engineering findings, conclusions, and recommendations.

Under-floor Crawl Space

The area within the confines of the foundation and between the ground and the underside of the floor.

Unsafe

A condition in a readily accessible, installed system or component which is judged to be a significant risk of personal injury during normal, day-to-day use. The risk may be due to damage, deterioration, missing or improper installation.

Vapour Barrier

Material used in the building envelope to retard the passage of water vapour or moisture.

Visually Accessible

Able to be viewed by reaching or entering. Wiring Methods

Identification of electrical conductors or wires by their general type,

such as "non-metallic sheathed cable" ("Romex"), "armored cable" ("bx") or "knob and tube", etc.

Use of this HIABC Scope of Inspection does not guarantee that the Inspector is a member of the Home Inspectors Association BC. To confirm membership, visit www.hiabc.ca

Home Inspectors Association BC www.hiabc.ca Scope of Inspection 2016 5